

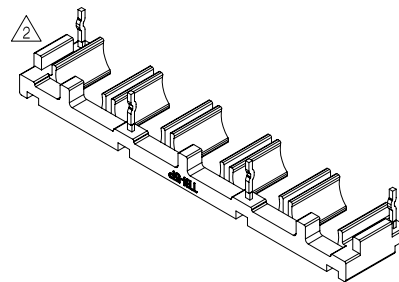
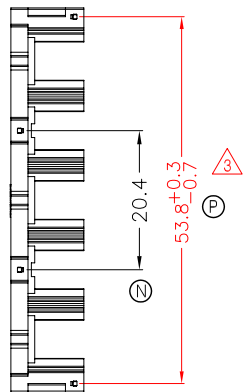
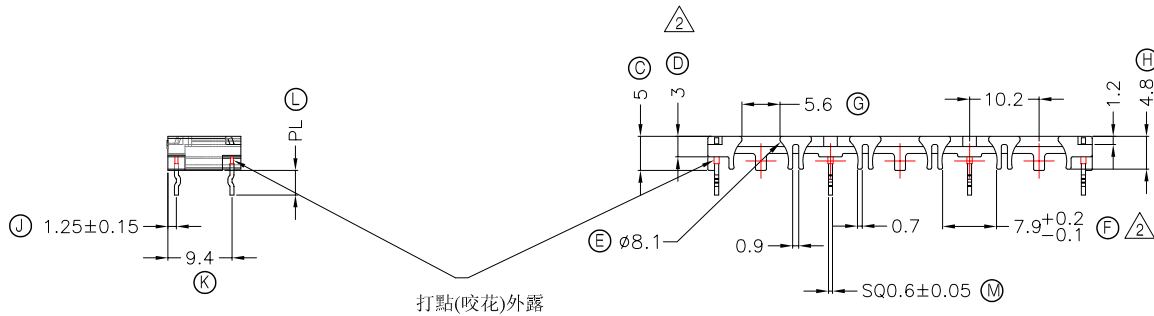


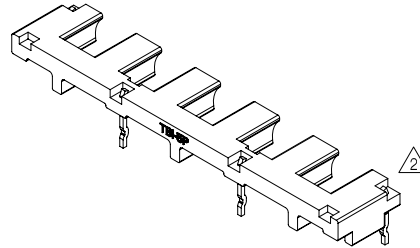

TRANSFORMER BOBBIN INDUSTRIAL CO.,LTD.

Tel : 86-769-88789999 Fax : 86-769-88789989
 http:// tbi-tw.com e-mail : tb6688@ms46.hinet.net

REVISIONS				
REV	SYM	DRAFTER	CHECKER	DATE
①		X.H.GU	G.F.YANG	01/17/13
②		F.LU	G.F.YANG	03/26/13
③		X.H.GU	G.F.YANG	12/17/13

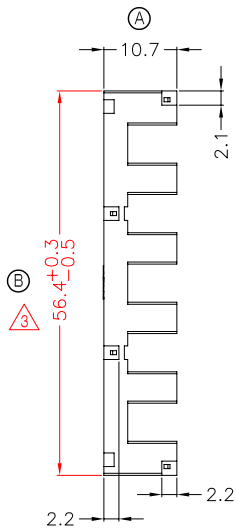

DWG NO.	5CAP-4P-TH-A2-75				
PART NO.	MATERIAL (BOBBIN)	MATERIAL (TERMINAL)	TERMINAL (PLATING)	PIN ALLOCATION	NOTE
TBI-220-24121.7506	Nylon HTN FR52G30NH(BK)	CP WIRE	Sn	ALL PIN PL=3.6±0.3	S
TBI-220-24121.7516	Nylon HTN FR52G30NH(BK)	CP WIRE	Sn	ALL PIN PL=3.3±0.3	H

	TOLERANCE: 0<L<=4: ±0.1 4<L<=16: ±0.2 16<L<=: ±0.3	UNIT : m / m	SCALE 1 : 1
--	--	--------------	-------------







Finish:	1. PB wire Immersion Sn on terminal : Thickness:Sn plating,100,5 μm (200 μ inches) min,Base nickel 0.625 μm (25 μ inches) min. 2. CP wire Immersion Sn on terminal : Thickness:Sn plating,100,5 μm (200 μ inches) min. 3. Coplanarity deviation: 0.10 mm (0.004 inches) max.	REV	3
---------	--	-----	---



**TRANSFORMER BOBBIN
INDUSTRIAL CO.,LTD.**


Tel : 86-769-88789999 Fax : 86-769-88789989
 http:// tbi-tw.com e-mail : tb6688@ms46.hinet.net

REVISIONS				
REV	SYM	DRAFTER	CHECKER	DATE
①		X.H.GU	G.F.YANG	01/17/13
②		F.LU	G.F.YANG	03/26/13
③				

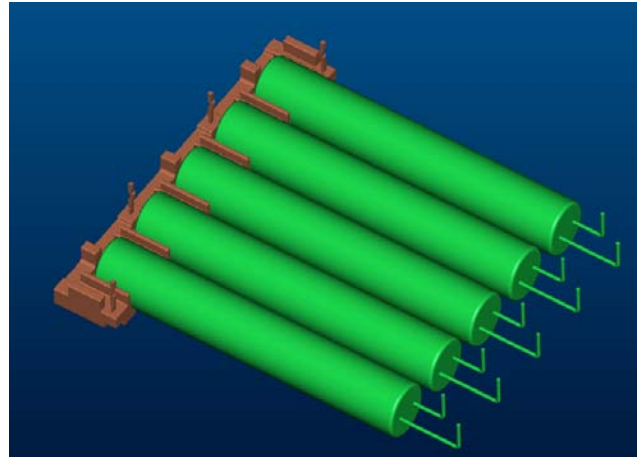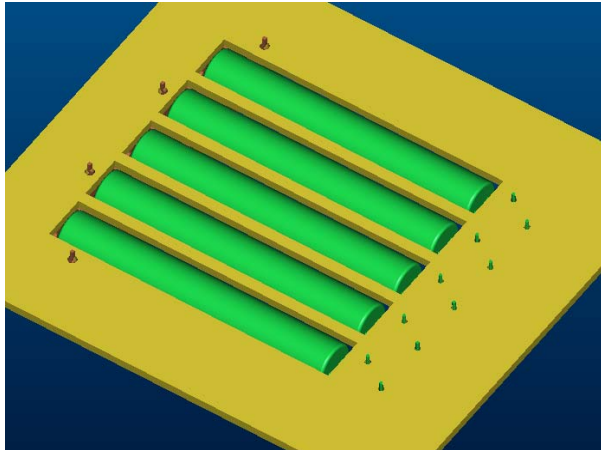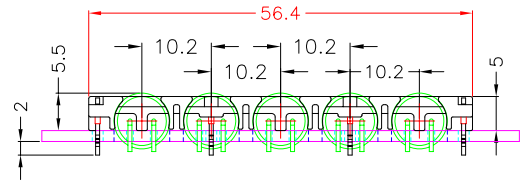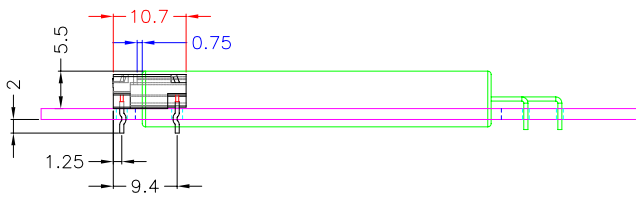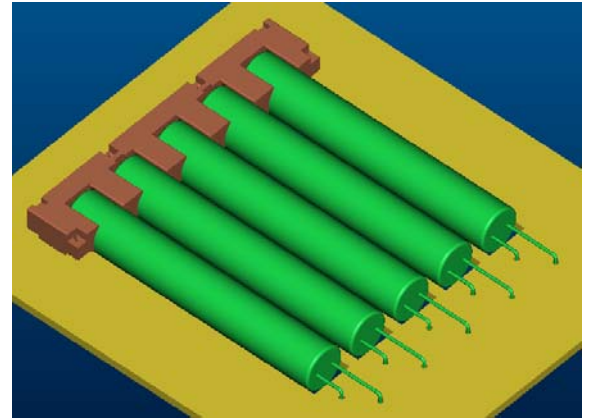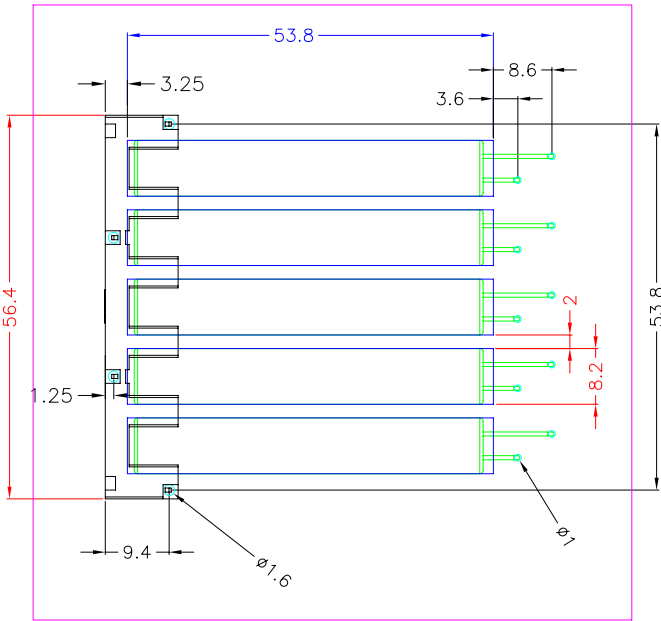

DWG NO. 5CAP-4P-TH-A2-75-ASM

PART NO.	MATERIAL (BOBBIN)	MATERIAL (TERMINAL)	TERMINAL (PLATING)	PIN ALLOCATION	NOTE



TOLERANCE: 0<L<=4: ±0.1 4<L<=16: ±0.2 16<L<=: ±0.3

UNIT : m/m

SCALE 1 : 1

REV 2